



# Miami-Dade NOA

NOA NO: 23-1122.07

Approved Products: PN# 16319, 16320, 17772



Part #	Box Quantity
16319	36 Mounts + 144 Screws w/ EPDM Washers
16320	36 Black Mounts + 144 Screws w/ EPDM Washers
17772	36 Mounts with T-Bolt + Nut + 144 Screws w/ EPDM Washers

# TABLE OF CONTENTS

**3** MIAMI-DADE NOTICE OF ACCEPTANCE (NOA)

---

**7** ENGINEERING REPORT #1  
LOAD TESTING - DIRECT TO DECK

---

**22** ENGINEERING REPORT #2  
LOAD TESTING - RAFTER MOUNTED

---

**30** ENGINEERING REPORT #3  
TAS 100(A)-95 WIND DRIVEN RAIN RESISTANCE

---



DEPARTMENT OF REGULATORY AND ECONOMIC RESOURCES (RER)  
BOARD AND CODE ADMINISTRATION DIVISION  
**NOTICE OF ACCEPTANCE (NOA)**

MIAMI-DADE COUNTY  
PRODUCT CONTROL SECTION  
11805 SW 26 Street, Room 208  
Miami, Florida 33175-2474  
T (786) 315-2590 F (786) 315-2599  
[www.miamidade.gov/economy](http://www.miamidade.gov/economy)

**Quickscrews Int'l Corp.**  
5830 Las Positas Rd.  
Livermore, CA 94551

**SCOPE:**

This NOA is being issued under the applicable rules and regulations governing the use of construction materials. The documentation submitted has been reviewed and accepted by Miami-Dade County RER-Product Control Section to be used in Miami-Dade County and other areas where allowed by the Authority Having Jurisdiction (AHJ).

This NOA shall not be valid after the expiration date stated below. The Miami-Dade County Product Control Section (In Miami-Dade County) and/ or the AHJ (in areas other than Miami-Dade County) reserve the right to have this product or material tested for quality assurance purposes. If this product or material fails to perform in the accepted manner, the manufacturer will incur the expense of such testing and the AHJ may immediately revoke, modify, or suspend the use of such product or material within their jurisdiction. RER reserves the right to revoke this acceptance if it is determined by Miami-Dade County Product Control Section that this product or material fails to meet the requirements of the applicable building code.

This product is approved as described herein and has been designed to comply with the Florida Building Code, including the High Velocity Hurricane Zone.

**DESCRIPTION: QuickBOLT Butyl Bottom Stainless Steel Deck Solar Mount**

**APPROVAL DOCUMENT:** Drawing No. **QBDM-HZ**, titled "QuickBOLT Butyl Deck Mount Solar Bracket" Microflashing", sheets 1 through 2 of 2, prepared by QuickBolt a div of Quickscrews Int'l Corp., dated on 03/14/2024, signed and sealed by Scott Wolters, P.E., bearing the Miami-Dade County Product Control approval stamp with the Notice of Acceptance number and approval date by the Miami-Dade County Product Control Section.

**MISSILE IMPACT RATING: None**

**LABELING:** Each box shall bear a permanent label with the manufacturer's name or logo, city, state and following statement: "Miami-Dade County Product Control Approved or MDCPCA", unless otherwise noted herein.

**RENEWAL** of this NOA shall be considered after a renewal application has been filed and there has been no change in the applicable building code negatively affecting the performance of this product.

**TERMINATION** of this NOA will occur after the expiration date or if there has been a revision or change in the materials, use, and/or manufacture of the product or process. Misuse of this NOA as an endorsement of any product, for sales, advertising or any other purposes shall automatically terminate this NOA. Failure to comply with any section of this NOA shall be cause for termination and removal of NOA.

**ADVERTISEMENT:** The NOA number preceded by the words Miami-Dade County, Florida, and followed by the expiration date may be displayed in advertising literature. If any portion of the NOA is displayed, then it shall be done in its entirety.

**INSPECTION:** A copy of this entire NOA shall be provided to the user by the manufacturer or its distributors and shall be available for inspection at the job site at the request of the Building Official.

This NOA consists of this page 1, evidence page E-1, as well as approval document mentioned above.

The submitted documentation was reviewed by **Carlos M. Utrera, P.E.**



  
04/17/24

NOA No: 23-1122.07  
Expiration Date: April 25, 2029  
Approval Date: April 25, 2024  
Page 1

**NOTICE OF ACCEPTANCE: EVIDENCE SUBMITTED**

**A. DRAWINGS**

1. Drawing No. **QBDM-HZ**, titled “QuickBOLT Butyl Deck Mount Solar Bracket” Microflashing”, sheets 1 through 2 of 2, prepared by QuickBolt a div of Quickscrews Int'l Corp., dated on 03/14/2024, signed and sealed by Scott Wolters, P.E.

**B. TESTS**

1. Test report on Uplift and Shear Allowable Loads of the Butyl Bottom Deck Mounts per ASTM D7147-21, prepared by Intertek, Test Report No. **Q6437.01-106-18 R2**, dated 11/17/2023, with revision dated 03/25/2024, signed and sealed by Tanya A. Dolby, P.E.
2. Test report on Wind Driven Rain Resistance of the Butyl Bottom Deck Mounts per TAS 100(A)-95, prepared by Intertek, Test Report No. **P9590.02-109-18**, dated 08/07/2023, signed and sealed by Tanya A. Dolby, P.E.

**C. CALCULATIONS**

1. Anchor calculations prepared by Wolters Engineering, Inc., dated 02/13/2024, signed and sealed by Scott Wolters, P.E.

**D. MATERIAL CERTIFICATIONS**

1. None.

**E. QUALITY ASSURANCE**

1. Miami-Dade Department of Regulatory and Economic Resources (RER).

**F. STATEMENTS**

1. Statement letter of code conformance to the 8<sup>th</sup> edition (2023) of the FBC, issued by Wolters Engineering, Inc., dated 02/13/2024, signed and sealed by Scott Wolters, P.E.
2. Statement letter of no financial interest, issued by Wolters Engineering, Inc., dated 02/13/2024, signed and sealed by Scott Wolters, P.E.
3. Distributor agreement dated 01/17/2024.



---


**Carlos M. Utrera, P.E.**  
**Product Control Examiner**  
**NOA No: 23-1122.07**  
**Expiration Date: April 25, 2029**  
**Approval Date: April 25, 2024**

**E - 1**

# QUICKBOLT PN 16319/16320 BUTYL DECK MOUNT SOLAR BRACKET

**GENERAL NOTES:**

1. THIS SYSTEM HAS BEEN DESIGNED AND TESTED TO MEET ALL OF THE REQUIREMENTS OF THE 8TH EDITION (2023) FLORIDA BUILDING CODE, INCLUDING THE HVHZ PROVISIONS.
2. THIS SYSTEM HAS BEEN TESTED PER TAS 100(A) AND ASTM D7147.
3. THE DESIGN OF THE SUBSTRATE IS THE RESPONSIBILITY OF THE ENGINEER OF RECORD OR OTHER SPECIALTY ENGINEER, AND IS NOT A PART OF THIS APPROVAL. THE SUBSTRATE MUST SAFELY TRANSMIT THE LOADS APPLIED TO THIS SYSTEM TO THE BUILDING STRUCTURE.
4. FIRE RATINGS OR FIRE RESISTANCE IS NOT A PART OF THIS REVIEW.
5. ALL ANCHORS SECURING THE SYSTEM TO PRESSURE TREATED WOOD SHALL BE CAPABLE OF RESISTING CORROSION CAUSED BY THE CHEMICALS IN THE WOOD.
6. MATERIALS INCLUDING BUT NOT LIMITED TO STEEL/METAL SCREWS THAT COME INTO CONTACT WITH OTHER DISSIMILAR MATERIALS SHALL BE PROTECTED PER FBC REQUIREMENTS.
7. NO INCREASE IN ALLOWABLE STRESS HAS BEEN USED IN THE DESIGN OF THIS PRODUCT. Cd=1.6 WAS USED FOR WOOD SCREWS ONLY.
8. THE ALLOWABLE LOADS SHOWN ARE BASED ON FASTENING TO THE 19/32" (min) PLYWOOD SHEATHING ONLY. THE SHEATHING AND ITS CONNECTION TO SUPPORTS/RAFTERS ARE NOT A PART OF THIS APPROVAL, AND MUST BE VERIFIED BY THE ENGINEER OF RECORD.
9. BRACKET FASTENERS MUST FULLY PENETRATE THE 19/32" (min) SHEATHING, WITH 3 THREADS (min) BEYOND.

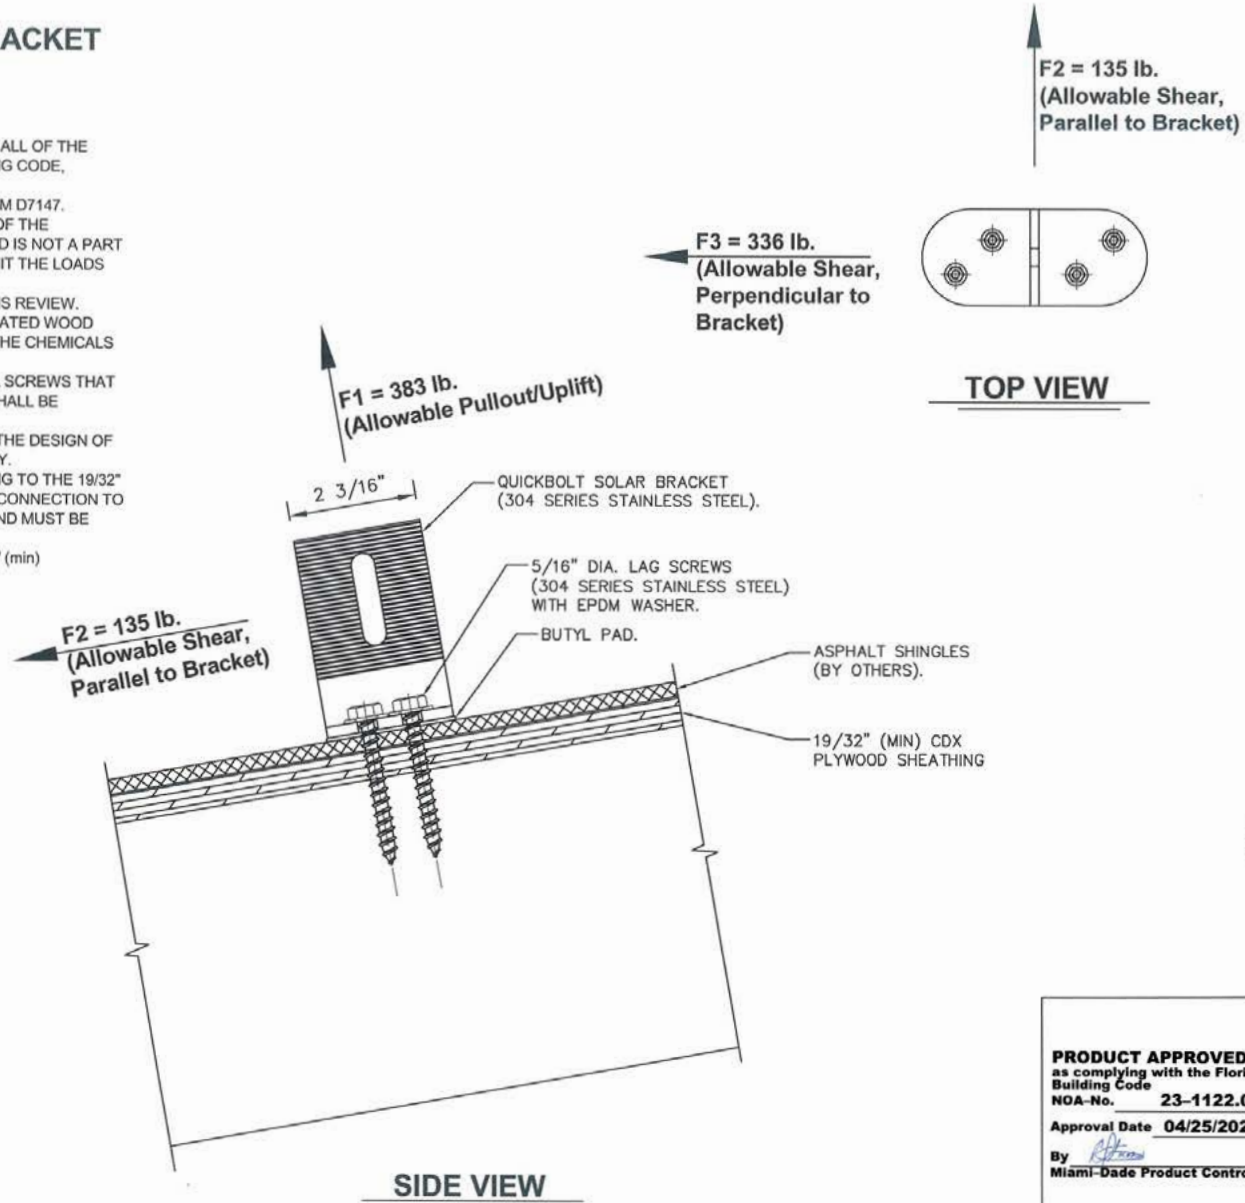

REV.#	DATE	DESCRIPTION
1	3/14/24	1ST SUBMITTAL
	2/2/24	

**QuickBOLT**  
World's First UL Certified Microflashing®  
5830 LAS POSITAS RD  
LIVERMORE, CA 94551  
PH: (844) 671-6045  
WWW.QUICKBOLT.COM




**PRODUCT APPROVED**  
as complying with the Florida  
Building Code  
NOA-No. **23-1122.07**  
Approval Date **04/25/2024**  
By *[Signature]*  
Miami-Dade Product Control

SCOTT WALTERS  
FL PE# 62354  
WALTERS ENGINEERING  
(CO# 27194)  
15211 07TH ROAD N 33412  
WEST PALM BEACH, FL 33412  
PH/FAX: (561) 225-1962

PRODUCT:  
**QUICKBOLT BUTYL  
DECK MOUNT  
SOLAR BRACKET**  
DWG: **QBDM-HZ**  
SHEET: **1/2**

**QUICKBOLT PN 16319/16320  
BUTYL DECK MOUNT SOLAR BRACKET**

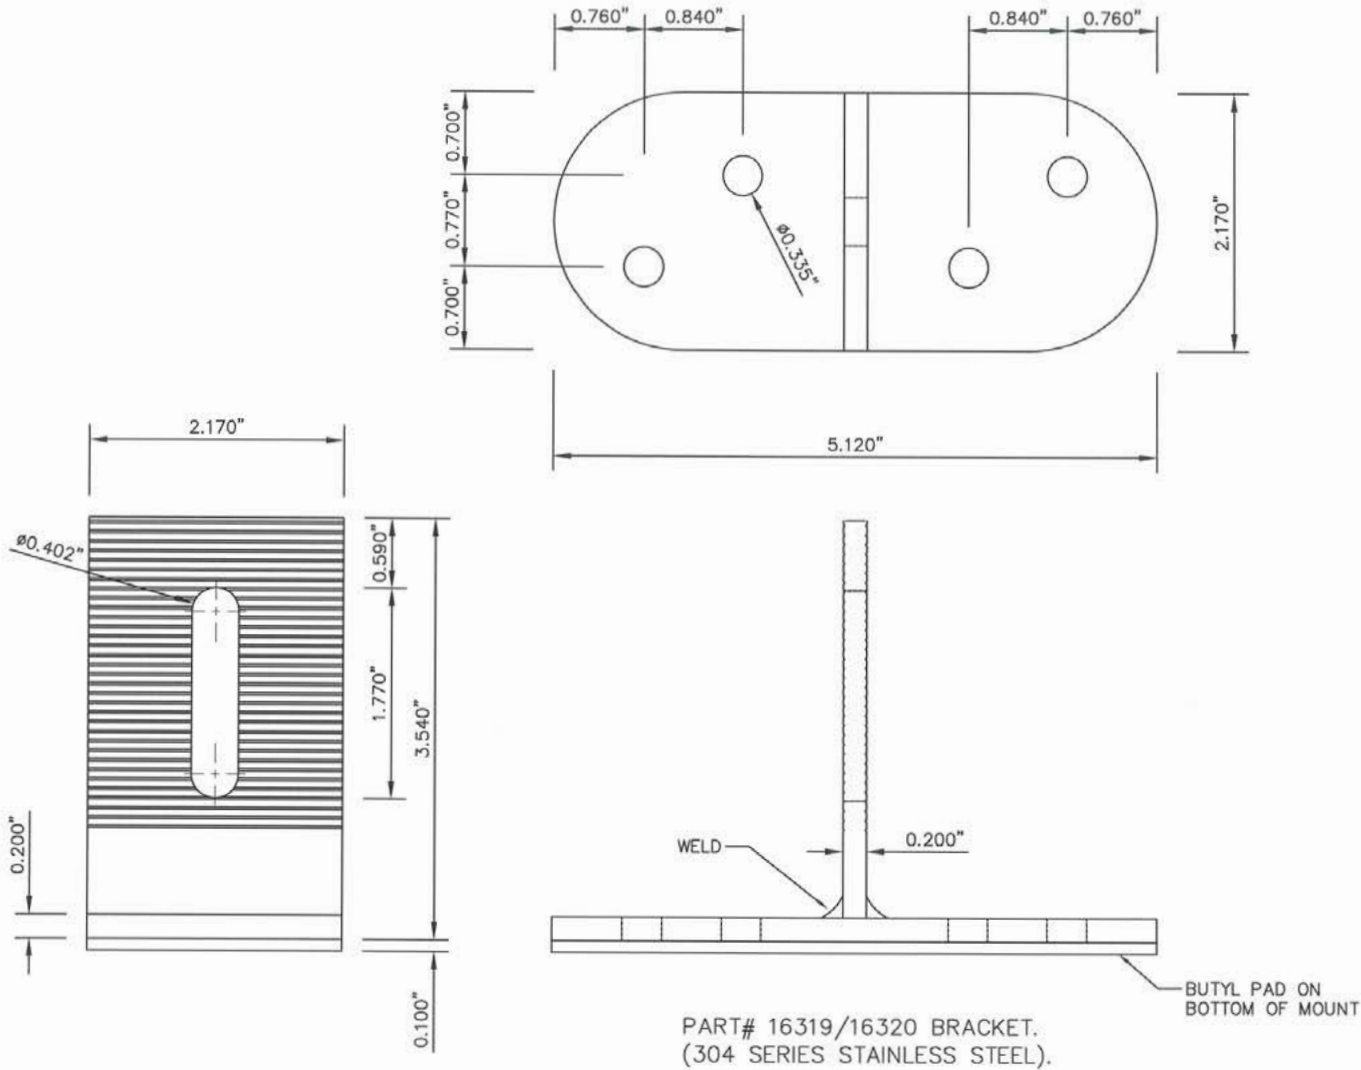

REV.#	DATE	DESCRIPTION
1	3/14/24	1ST SUBMITTAL
2	2/2/24	PRINTS ISSUED FOR

**QuickBOLT**  
World's First UL Certified Microfastening®  
5830 LAS POSITAS RD PH: (844) 671-6045  
LIVERMORE, CA 94551 WWW.QUICKBOLT.COM



SCOTT WALTERS  
FL PE# 62354  
WALTERS ENGINEERING  
LLC (COMP. 27194)  
15211 97TH ROAD, N.W. #412  
WEST PALM BEACH, FL 33412  
PH/FAX: (561) 225-1882

**PRODUCT APPROVED**  
as complying with the Florida  
Building Code  
NOA-No. **23-1122.07**  
Approval Date **04/25/2024**  
By *[Signature]*  
Miami-Dade Product Control

PRODUCT:  
**QUICKBOLT BUTYL  
DECK MOUNT  
SOLAR BRACKET**  
DWG:  
SHIRT: **QBDM-HZ  
2/2**

# ENGINEERING REPORT #1

## LOAD TESTING - DIRECT TO DECK



# QUICKSCREWS INTERNATIONAL CORPORATION

## MIAMI-DADE TEST REPORT

### SCOPE OF WORK

ASTM D7147 BRACKET LOAD EVALUATIONS OF BUTYL BOTTOM DECK MOUNTS

### REPORT NUMBER

Q6437.01-106-18 R0

### TEST DATES

11/01/23 - 11/01/23

### ISSUE DATE

11/17/23

### RECORD RETENTION END DATE

11/01/33

### PAGES

15

### DOCUMENT CONTROL NUMBER

RT-R-AMER-Test-2827 (07/12/22)

© 2017 INTERTEK





Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
www.intertek.com/building

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23

**REPORT ISSUED TO**

**QUICKSCREWS INTERNATIONAL CORPORATION**

5830 Las Positas Road  
Livermore, California 94551

**SECTION 1**

**SCOPE**

**Product:** Butyl Bottom Deck Mount (16319/16320)

Architectural Testing, Inc. (an Intertek company) dba Intertek Building & Construction (B&C) was contracted by Quickscrews International Corporation to evaluate Butyl Bottom Deck Mount in accordance with ASTM D7147 for Bracket Loading. Results obtained are tested values and were secured by using the designated test method. Testing was conducted at the Intertek B&C test facility in York, Pennsylvania.

This report does not constitute certification of this product nor an opinion or endorsement by this laboratory.

Unless differently required, Intertek reports apply the "Simple Acceptance" rule, also called "Shared Risk approach," of ILAC-G8:09/2019, Guidelines on Decision Rules and Statements of Conformity.



For INTERTEK B&C:

<b>COMPLETED BY:</b>	Cag S. Saylor
<b>TITLE:</b>	Technician III Materials Laboratory
<b>SIGNATURE:</b>	 <small>Digitally Signed by: Cag Saylor</small>
<b>DATE:</b>	11/17/23

<b>REVIEWED BY:</b>	Tanya Dolby, P.E.
<b>TITLE:</b>	Manager Engineering Services
<b>SIGNATURE:</b>	 <small>Digitally Signed by: Tanya Dolby</small>
<b>DATE:</b>	2023.11.17 15:24:45 -05'00'

CSS:jmb/td/kae

This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to permit copying or distribution of this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample(s) tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.

Version: 07/12/22

Page 2 of 15

RT-R-AMER-Test-2827





Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
www.intertek.com/building

## TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION

Report No.: Q6437.01-106-18 R0

Date: 11/17/23

### SECTION 2

#### TEST METHODS

The specimens were evaluated in accordance with the following:

**ASTM D7147-21**, *Standard Test Specification for Testing and Establishing Allowable Loads of Joist Hangers*

### SECTION 3

#### MATERIAL SOURCE

The materials were provided by Quickscrews International Corporation. The following were received in good condition on 4/13/23:

- Ten (10), Butyl Bottom Deck Mounts

Refer to the product description photos in Section 10 and the drawings in Section 11. The materials were tested as received, except for preparing test specimens from the original materials. Representative materials/test specimens will be retained by Intertek B&C for a minimum of four years from the test completion date.

### SECTION 4

#### TEST EQUIPMENT

NAME	ICN
INSTRON Model UTM	INT02020
30 kN Load Cell	INT02023
Digital Caliper	INT02510



Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
www.intertek.com/building

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23

**SECTION 5**

**LIST OF OFFICIAL OBSERVERS**

NAME	COMPANY
Cag S. Saylor	Intertek B&C
Joseph M. Brickner	Intertek B&C
Tanya Dolby, P.E.	Intertek B&C

**SECTION 6**

**TEST PROCEDURE**

All conditioning of test specimens and test conditions were at standard laboratory conditions unless otherwise reported. Refer to the test related photos in Section 10. Calibration certificates are available on request.

**ASTM D7147 - Vertical, Torsional, and Bending Loads**

Specimens for the load tests were assembled out of nominal 2" x 4" lumber frames covered with 19/32" thick plywood and GAF Timberline HDZ shingles. The Butyl Bottom Deck Mounts were centered and fastened with 4, 5/16" x 2-1/2" lag screws into the frame through the plywood without a center joist. Three specimens were tested per configuration (See Drawing in Section 11). Specimens were tested utilizing a INSTRON UTM (ICN: INT02020) equipped with a 30 kN load cell (ICN: INT02023) and loaded in tension or compression at a rate of 0.10 in/min depending on the configuration. Maximum load and displacement were recorded.

**SECTION 7**

**TEST SPECIMEN DESCRIPTIONS**

TEST PROCEDURE	NUMBER OF SPECIMENS	NOMINAL SPECIMEN DIMENSIONS
ASTM D7147 – Vertical, Torsional, Bending Loading Tests	3 per configuration	16" x 16" x 4"



Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
www.intertek.com/building

### TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION

Report No.: Q6437.01-106-18 R0

Date: 11/17/23

#### SECTION 8

#### TEST RESULTS

##### Vertical Loading (Configuration F1, See Drawing in Section 11)

SPECIMEN NO.	MAXIMUM LOAD (lbf)	DISPLACEMENT (in)
1 – 16319,16320	1,410	0.646
2 – 16319,16320	1,150	0.544
3 – 16319,16320	1,360	0.602
<b>Average</b>	<b>1,310</b>	<b>0.597</b>
Std. Dev.	137	0.05

##### Torsional Loading (Configuration F2, See Drawing in Section 11)

SPECIMEN NO.	MAXIMUM LOAD (lbf)	DISPLACEMENT (in)
1 – 16319,16320	460	0.960
2 – 16319,16320	406	1.309
3 – 16319,16320	513	0.703
<b>Average</b>	<b>460</b>	<b>0.991</b>
Std. Dev.	53.5	0.304

##### Bending Load (Configuration F3, See Drawing in Section 11)

SPECIMEN NO.	MAXIMUM LOAD (lbf)	DISPLACEMENT (in)
1 – 16319,16320	1,010	0.599
2 – 16319,16320	1,080	0.564
3 – 16319,16320	1,130	0.463
<b>Average</b>	<b>1,073</b>	<b>0.542</b>
Std. Dev.	60.3	0.071

#### SECTION 9

#### CONCLUSION

The requested test method does not contain specific performance requirements. Results are reported as obtained.

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23

**SECTION 10**

**PHOTOGRAPHS**



**Photo No. 1**  
**Material as Received**



**Photo No. 2**  
**Specimen Test Deck**

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23



**Photo No. 3**  
**ASTM D7147 - Configuration F3 Test Setup**



**Photo No. 4**  
**ASTM D7147 - Configuration F3 Test in Progress**

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23



**Photo No. 5**  
**ASTM D7147 - Configuration F3 Test in Progress**



**Photo No. 6**  
**ASTM D7147 - Configuration F2 Test Setup**

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23



**Photo No. 7**  
**ASTM D7147 - Configuration F2 Test in Progress**



**Photo No. 8**  
**ASTM D7147 - Configuration F2 Test in Progress**

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23



**Photo No. 9**  
**ASTM D7147 – Configuration F1 Vertical Load Test Setup**



**Photo No. 10**  
**ASTM D7147 – Configuration F1 Vertical Load Test in Progress**



**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23



**Photo No. 11**

**ASTM D7147 – Configuration F1 Vertical Load Test in Progress**



**Photo No. 12**

**ASTM D7147 – Configuration F1 Vertical Load Test in Progress**


**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23

**SECTION 11**

**DRAWINGS**

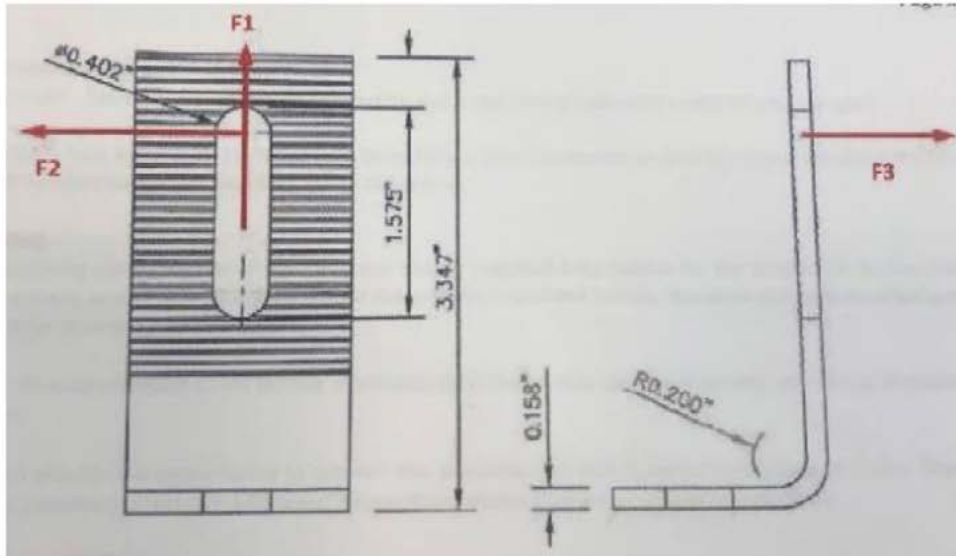


**Load Orientation Details**

**BUTYL DECK MOUNT - QUICKBOLT PN16319/16320**


**GENERAL NOTES:**

1. THIS SYSTEM HAS BEEN DESIGNED AND TESTED TO MEET ALL OF THE REQUIREMENTS OF THE 8TH EDITION (2023) FLORIDA BUILDING CODE, INCLUDING THE HMZ PROVISIONS.
2. THIS SYSTEM HAS BEEN TESTED PER TAS 100(A) AND ASTM D7147.
3. THE DESIGN OF THE SUBSTRATE IS THE RESPONSIBILITY OF THE ENGINEER OF RECORD OR OTHER SPECIALTY ENGINEER, AND IS NOT A PART OF THIS APPROVAL. THE SUBSTRATE MUST SAFELY TRANSMIT THE LOADS APPLIED TO THIS SYSTEM TO THE BUILDING STRUCTURE.
4. FIRE RATINGS OR FIRE RESISTANCE IS NOT A PART OF THIS REVIEW.
5. ALL ANCHORS SECURING THE SYSTEM TO PRESSURE TREATED WOOD SHALL BE CAPABLE OF RESISTING CORROSION CAUSED BY THE CHEMICALS IN THE WOOD.
6. MATERIALS INCLUDING BUT NOT LIMITED TO STEEL METAL SCREWS THAT COME INTO CONTACT WITH OTHER DISSIMILAR MATERIALS SHALL BE PROTECTED PER FBC REQUIREMENTS.
7. NO INCREASE IN ALLOWABLE STRESS HAS BEEN USED IN THE DESIGN OF THIS PRODUCT.

TOP VIEW BUTYL DECK MOUNT

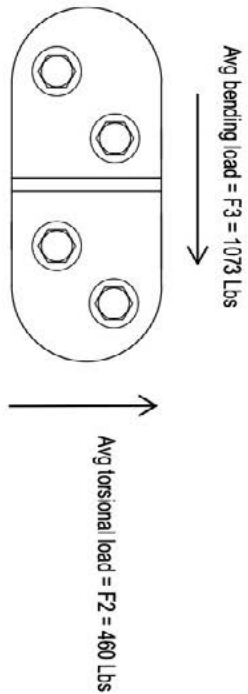

SIDE VIEW BUTYL DECK MOUNT



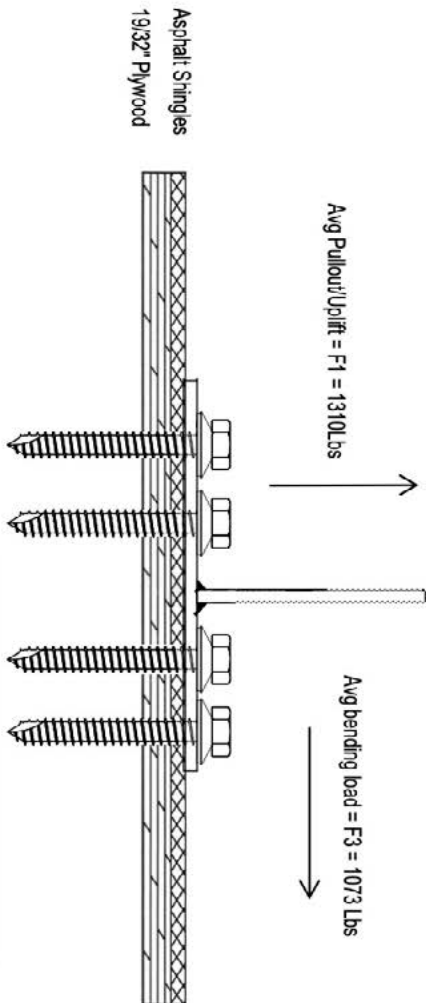


<b>Intertek</b> <small>Real Quality. Assured.</small>	Report #:	<b>Q6437.01</b>
	Date:	11/15/23
	Verified by:	<i>[Signature]</i>





**BUTYL DECK MOUNT - QUICKBOLT PN16319/16320**

Measurements are in mm

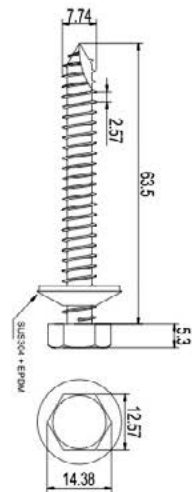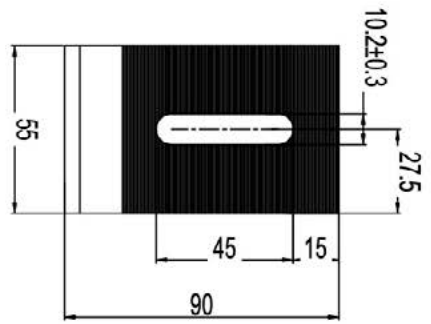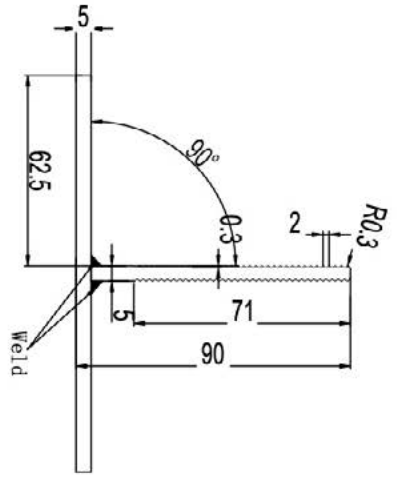

<p>Intertek Product Quality Assurance</p>	Report #:	Q6437.01
	Date:	11/15/23
	Verified by:	<i>[Signature]</i>

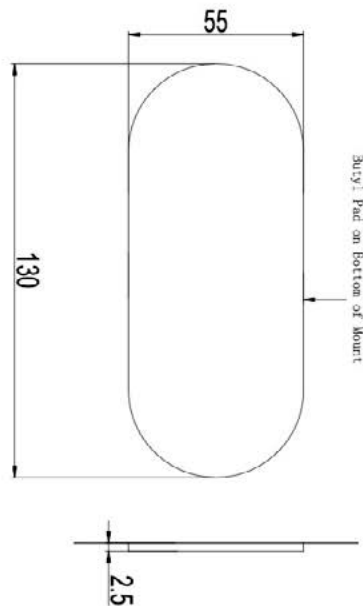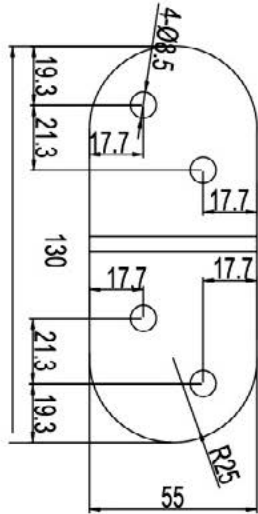



Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
www.intertek.com/building

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: Q6437.01-106-18 R0

Date: 11/17/23

**SECTION 12**

**REVISION LOG**

REVISION #	DATE	PAGES	REVISION
0	11/17/23	N/A	Original Report Issue

# ENGINEERING REPORT #2

## LOAD TESTING - RAFTER MOUNTED



APPLIED MATERIALS & ENGINEERING, INC.

980 41<sup>st</sup> Street  
Oakland, CA 94608

Tel: (510) 420-8190  
FAX: (510) 420-8186  
e-mail: info@appmateng.com

January 4, 2023

Mr. Rick Gentry  
**QUICKSCREWS INTERNATIONAL**  
5830 Las Positas Road  
Livermore, CA 94551

Project Number 1220938C

**Subject:** Deck Mount Butyl Kit 36M-144S/CS (Part # 16319, 16320) Laboratory Load Testing

Dear Mr. Gentry:

As requested, Applied Materials & Engineering, Inc. (AME) has completed load-testing the Deck Mount Butyl Kit 36M-144S/CS (Part # 16319). The purpose of our testing was to evaluate the tensile and shear load capacity of the Deck Mount attached to a 2"x6" Douglas Fir rafter using four (4) 5/16"Øx2-1/2" lag screws.

### **SAMPLE DESCRIPTION**

Six Deck Mount Butyl Kits with 2"x6" Douglas Fir samples were delivered to our laboratory on December 9, 2022. Mockup configuration consisted of three 12" long rafters at 6.5" o.c., screwed to 1/2" Structural I plywood. The Deck Mount is attached through the plywood into a rafter with four 5/16"Øx2-1/2" lag screws.

### **TEST PROCEDURES & RESULTS**

#### **1. Tensile Load Test**

A total of three tests were conducted for tensile (uplift) load capacity on December 28, 2022 using a United Universal testing machine. Samples were rigidly attached to the testing machine and a tensile load was applied to the hook. The samples were loaded in tension at a constant rate of axial deformation of 0.10 in./min. without shock until failure occurred; displacement at maximum load was recorded. Based on the above testing, the average maximum tensile load and displacement of the Deck Mount Butyl Kit attached to a 2"x6" Douglas Fir rafter using four 5/16"Øx2-1/2" lag screws was determined to be 3238 lbf and 0.4 in., respectively. Detailed results are provided in Table I and tensile load vs. displacement curves are provided in Figure 1. Test setup and mode of failure are provided in Appendix A, Figure 3.

The specific gravity and moisture content of the rafter was tested in accordance with ASTM D2395, Method A (oven-dry). The average specific gravity and moisture content were determined to be 0.493 and 16.3%, respectively.

Mr. Rick Gentry

**Quickscrews International**

Deck Mount Butyl Kit 36M-144S/CS (Part # 16319, 16320) Laboratory Load Testing

January 4, 2023

**3. Shear Load Test Parallel to Rafter**

A total of three tests were conducted for shear load capacity parallel to the rafter on December 29, 2022 using a United Universal testing machine. Samples were rigidly attached to the testing machine and a tensile load was applied to the hook. The samples were loaded in compression at a constant rate of axial deformation of 0.10 in. /min. without shock until failure occurred; displacement at maximum load was recorded. Based on the above testing, the average maximum tensile load and displacement of the Deck Mount Butyl Kit attached to a 2"x6" Douglas Fir rafter using four 5/16"Øx2-1/2" lag screws was determined to be 5234 lbs and 2.1 in., respectively. Detailed results are provided in Table II and shear load vs. displacement curves are provided in Figure 2. Test setup and mode of failure are provided in Appendix A, Figure 4.

The specific gravity and moisture content of the rafter was tested in accordance with ASTM D2395, Method A (oven-dry). The average specific gravity and moisture content were determined to be 0.448 and 17.7%, respectively.

Respectfully Submitted,

**APPLIED MATERIALS & ENGINEERING, INC.**

**Reviewed by:**

---

Armen Tajirian, Ph.D., P.E.  
Principal

**TABLE I**

**TENSILE (UPLIFT) LOAD TEST RESULTS**

**DECK MOUNT BUTYL KIT 36M-144S/CS (Part # 16319, 16320)**

**PROJECT NUMBER 1220938C**

<b>TEST NUMBER</b>	<b>MAXIMUM TENSILE LOAD (lbf)</b>	<b>DISPLACEMENT AT MAXIMUM LOAD (in.)</b>	<b>MODE OF FAILURE</b>	<b>RAFTER SPECIFIC GRAVITY</b>	<b>RAFTER MOISTURE CONTENT (%)</b>
8173	3613	0.4	Rafter Split	0.508	15.4
8174	2949	0.4		0.411	19.2
8175	3153	0.3		0.560	14.2
<b>AVERAGE</b>	<b>3238</b>	<b>0.4</b>	<b>..</b>	<b>0.493</b>	<b>16.3</b>



TENSILE LOAD-DISPLACEMENT CURVES



Report No 1639 Tensile Test - XHD Control

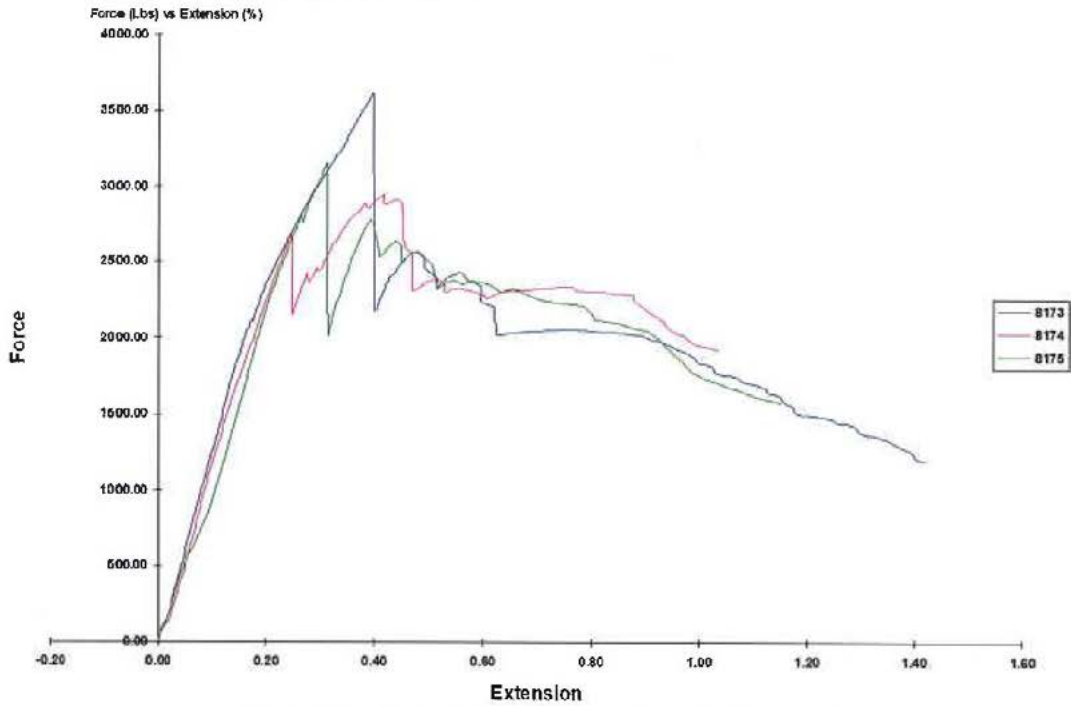


Figure 1. Test 8173, 8174, 8175 tensile load vs. displacement curve.

**TABLE II**

**SHEAR LOAD TEST RESULTS**

**DECK MOUNT BUTYL KIT 36M-144S/CS (Part # 16319, 16320)**

**PROJECT NUMBER 1220938C**

<b>TEST NUMBER</b>	<b>MAXIMUM SHEAR LOAD (lbf)</b>	<b>DISPLACEMENT AT MAXIMUM LOAD (in.)</b>	<b>MODE OF FAILURE</b>	<b>RAFTER SPECIFIC GRAVITY</b>	<b>RAFTER MOISTURE CONTENT (%)</b>
8176	7180	2.5	Bolt Shear	0.425	18.4
8177	4744	2.0	Mount Break	0.518	15.0
8178	3778	1.9	Mount Break	0.400	19.9
<b>AVERAGE</b>	<b>5234</b>	<b>2.1</b>	<b>..</b>	<b>0.448</b>	<b>17.7</b>

SHEAR LOAD-DISPLACEMENT CURVES



Report No 1640      Compressive Test - XHD Control  
Force (-Lbs) vs Extension (-Inches)

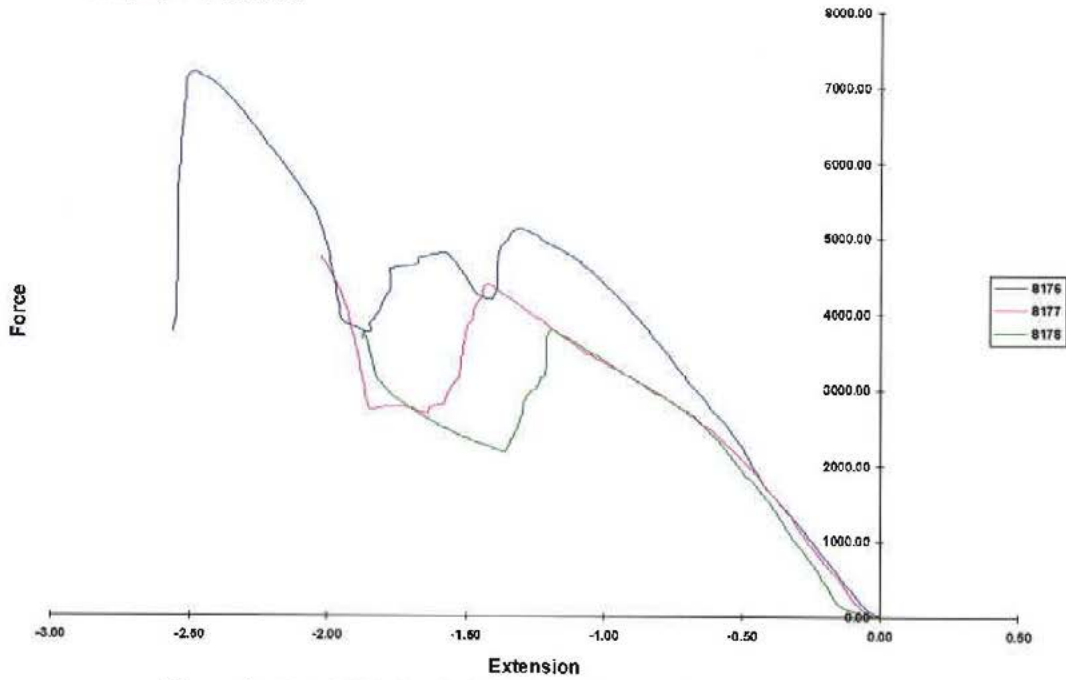


Figure 2. Test 8176, 8177, 8178 shear load vs. displacement curve.

**FIGURE 3**


**DECK MOUNT BUTYL KIT 36M-144S/CS (Part # 16319, 16320)**

**TENSILE (UPLIFT) LOAD TEST SETUP**


**PROJECT NUMBER 1220938C**



**Figure 3a.** Test setup.

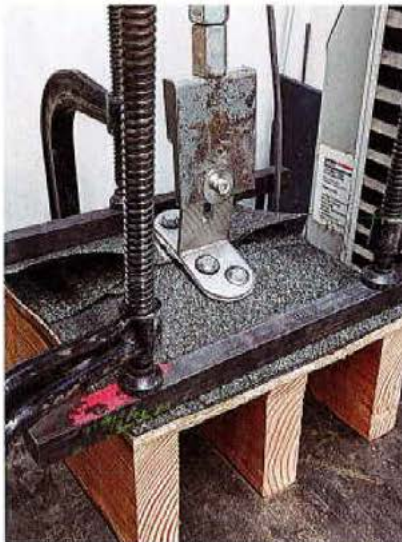

**Figure 3b.** Typical failure mode.

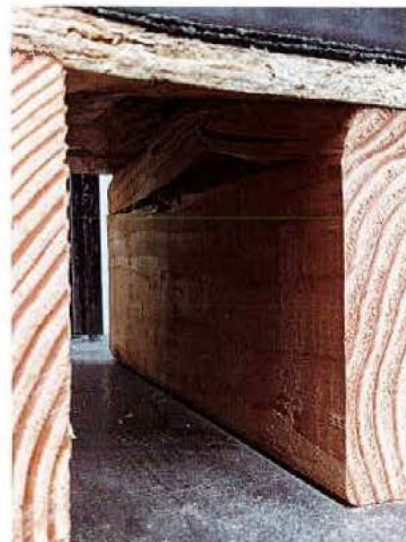

**Figure 3c.** Rafter view of typical failure

**FIGURE 4**

**DECK MOUNT BUTYL KIT 36M-144S/CS (Part # 16319, 16320)**

**SHEAR LOAD TEST SETUP**

**PROJECT NUMBER 1220938C**



**Figure 4a.** Test setup.



**Figure 4b.** Mount failure mode.



**Figure 4c.** Bolt failure mode.

# ENGINEERING REPORT #3

## TAS 100 (A)-95, WIND DRIVEN RAIN RESISTANCE



# QUICKSCREWS INTERNATIONAL CORPORATION

## MIAMI-DADE TEST REPORT

### SCOPE OF WORK

TAS 100(A)-95 TESTING ON THEIR QUICKBOLT, BUTYL BOTTOM DECK MOUNT (PN#16319/16320)

### REPORT NUMBER

P9590.02-109-18

### TEST DATE(S)

07/13/23

### ISSUE DATE

08/07/23

### MIAMI-DADE COUNTY NOTIFICATION NO.

ATI - 23006

### LABORATORY CERTIFICATION NO.

22-0428.14


### PAGES

16

### DOCUMENT CONTROL NUMBER

RT-R-AMER-Test-7808 (07/12/22)

© 2019 INTERTEK

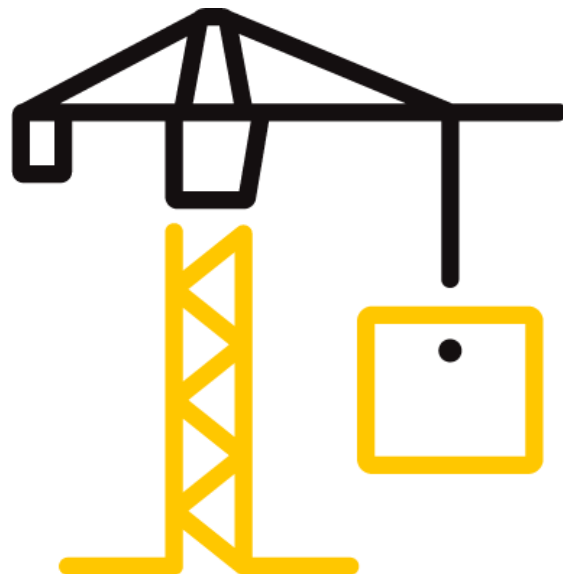

## TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION

Report No.: P9590.02-109-18

Date: 08/07/23

### REPORT ISSUED TO

#### QUICKSCREWS INTERNATIONAL CORPORATION

5830 Las Positas Road  
Livermore, California 94551

### SECTION 1


#### SCOPE

Architectural Testing, Inc. (an Intertek company) dba Intertek Building & Construction (B&C) was contracted by Quickscrews International Corporation to perform TAS 100(A) testing in accordance with Miami-Dade County requirements on their Butyl Bottom Deck Mount (PN#16319/16320), solar mount. Results obtained are tested values and were secured by using the designated test method(s). Testing was conducted at the Intertek B&C test facility in York, Pennsylvania.

### SECTION 2

#### SUMMARY OF TEST RESULTS

The specimen(s) tested met the performance requirements set forth in the protocols.

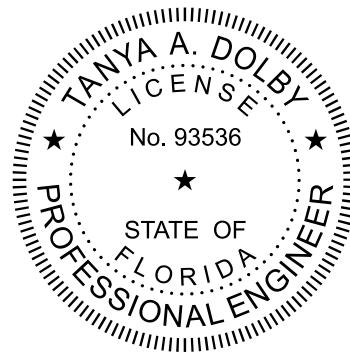

For INTERTEK B&C:

**COMPLETED BY:** Christopher E. Sartalis  
Technician –  
**TITLE:** Product Testing

**SIGNATURE:**   
Digitally Signed by: Christopher Sartalis

**DATE:** 08/07/23

**REVIEWED BY:** Tanya A. Dolby, P.E.  
Engineering Manager –  
**TITLE:** Engineering Services

**SIGNATURE:**   
Digitally Signed by: Tanya Dolby

**DATE:** 08/07/23

CES:bsm

2023.08.08 14:38:41 -04'00'

This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to permit copying or distribution of this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample(s) tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.



Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
www.intertek.com/building

## TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION

Report No.: P9590.02-109-18

Date: 08/07/23

### SECTION 3

#### TEST METHOD(S)

The specimen was evaluated in accordance with the following:

**TAS 100 (A)-95**, *Test Procedure for Wind and Wind Driven Rain Resistance and/or Increased Windspeed Resistance of Soffit Ventilation Strip and Continuous or Intermittent Ventilation System Installed at the Ridge Area*

### SECTION 4

#### MATERIAL SOURCE

Test sample materials were provided by the client from Quickscrews International Corporation located in Livermore, California. Representative samples of the test specimen(s) will be retained by Intertek B&C for a minimum of ten years from the test completion date.

### SECTION 5

#### EQUIPMENT/CALIBRATION

Vane Axial Fan: Y003346

Scale: 65571

Stopwatch: INT00974

Weather Station: 63317

Tape Measure Verifier: 63788

Windstream, water supply, and water distribution calibration were performed prior to testing. Reference Intertek B&C Calibration Report No. Q2311.02-109-18, dated 06/22/23, for descriptions and results.

### SECTION 6

#### LIST OF OFFICIAL OBSERVERS

NAME	COMPANY
Melchor C. George	Intertek B&C
Tanya A. Dolby, P.E.	Intertek B&C
Ken R. Stough	Intertek B&C
Christopher E. Sartalis	Intertek B&C





Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
www.intertek.com/building

## TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION

Report No.: P9590.02-109-18

Date: 08/07/23

### SECTION 7

#### TEST SPECIMEN DESCRIPTION

**Manufacturer:** Quickscrews international Corporation

**Product Type:** Solar Mount

**Series / Model:** Butyl Bottom Deck Mount (PN#16319/16320),

**Roof Deck Description:** An 8' 0" wide by 6' 0" long roof deck on a 2:12 slope was utilized. The roof deck consisted of #2 Spruce-Pine-Fir nominal 2x6 intermediate supports sheathed with APA 32/16 span rated 15/32" plywood sheathing. The intermediate supports were spaced 24" on center. The plywood was secured to the rafters with 8d common nails spaced 6" on center around the perimeter and 12" on center at the intermediate supports. 30# felt paper underlayment was utilized over the sheathing. Architectural shingles were then installed on the roof deck.

**Solar Mount Description/Installation:** The mount was 2-1/4" wide by 5" long by 3-1/2" high. The mount was placed flat 18" down from the ridge in the center of a single tab. Four 2-1/2" lag screws with self-sealing washer were utilized through the base of the mount and butyl in the deck.

**Conditioning:** The test deck was conditioned in a chamber at a temperature of 135°F for a total of sixteen continuous hours.

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: P9590.02-109-18

Date: 08/07/23

**SECTION 8**

**TEST RESULTS**

**Protocol TAS 100(A)-95, Test Procedure for Wind and Wind Driven Rain Resistance and/or Increased Windspeed Resistance of Soffit Ventilation Strip and Continuous or Intermittent Ventilation System Installed at the Ridge Area.**

**Test Date(s):** 07/13/23

The temperature during testing was 27°C (81°F). The results are tabulated as follows:

**Test Procedure:** The wind speed intervals were conducted as follows:

Interval No.	Wind Speed (mph)	Time (min)	Water Spray
1	35	15	On
2	0	5	Off
3	70	15	On
4	0	5	Off
5	90	15	On
6	0	5	Off
7	110	5	On
8	0	5	Off

**Test Results:** The TAS 100(A) test results are as follows:

Wind Speed	Results
35 mph	0.0 oz.
70 mph	0.0 oz.
90 mph	0.0 oz.
110 mph	0.0 oz.

**Allowable:** 13.92 oz.

**Result(s):** Pass

**Note 1:** Tested at a 2:12 roof pitch.



Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
[www.intertek.com/building](http://www.intertek.com/building)

## TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION

Report No.: P9590.02-109-18

Date: 08/07/23

### SECTION 9

#### CONCLUSION

This report does not constitute certification of this product nor an opinion or endorsement by this laboratory. Intertek B&C will service this report for the entire test record retention period. The test record retention period ends ten years after the test date. Test records, such as detailed drawings, datasheets, representative samples of test specimens, or other pertinent project documentation, will be retained for the entire test record retention period.

Unless differently required, Intertek reports apply the "Simple Acceptance" rule, also called "Shared Risk approach," of ILAC-G8:09/2019, Guidelines on Decision Rules and Statements of Conformity.

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: P9590.02-109-18

Date: 08/07/23

**SECTION 10**  
**PHOTOGRAPHS**



**Photo No. 1**  
**Top Side Before Testing**



**Photo No. 2**  
**Underside Before Testing**

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: P9590.02-109-18

Date: 08/07/23



**Photo No. 3**  
**35 MPH Top Side**



**Photo No. 4**  
**35 MPH Underside**

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: P9590.02-109-18

Date: 08/07/23



**Photo No. 5**  
**70 MPH Top Side**



**Photo No. 6**  
**70 MPH Underside**

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: P9590.02-109-18

Date: 08/07/23



**Photo No. 7**  
**90 MPH Top side**



**Photo No. 8**  
**90 MPH Underside**

**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: P9590.02-109-18

Date: 08/07/23



**Photo No. 9**  
**110 MPH Top Side**



**Photo No. 10**  
**110 MPH Underside**



**TEST REPORT FOR QUICKSCREWS INTERNATIONAL CORPORATION**

Report No.: P9590.02-109-18

Date: 08/07/23



**Photo No. 11**  
**Post Test Top Side**



**Photo No. 12**  
**Post Test Underside**